

## WARNING LIST

### Caution:

If the wrench lamp illuminates and the following phenomena occur on the vehicle without an error being displayed, it is not a fault. Take the appropriate corrective action.

Indication	Memory	Wrench lamp	Detection ECU	Phenomenon on vehicle	Content of warning	Appropriate corrective action
Water temperature gauge flashing	OB-1	–	4Y-ECS	Top speed and load lifting speed are limited. (Only when OPT equipped)	Overheat	Leave the vehicle at idle for a while
–	–	On	SAS/OPS	Swing lock control is always locked Knob offset occurrence Material handling disabled (mini lever) Material handling except lifting disabled	High battery voltage	Use a battery of the specified voltage
–	–	On	SAS/OPS	Swing lock control is always locked	Low battery voltage	Charge or replace the battery
–	–	On	SAS/OPS	Tilt operates to forward most tilt position	Forward tilt restriction angle not matching	Carry out matching for each item
–	–	On	SAS/OPS	Tilt disabled with the knob switch in the ON position	Auto leveling angle not matching	
–	–	On	SAS/OPS	Tilt operates to forward most tilt position Tilt disabled with the knob switch in the ON position	SAS/OPS NL load not matching (NL: No-load)	
–	–	On	SAS/OPS	Knob offset occurrence	Tire angle not matching	
–	–	On	SAS/OPS	Swing lock control disabled	Swing leveling not matching	
–	–	On	SAS/OPS	Lift stop	Lift lever not matching	
–	–	On	SAS/OPS	Tilt stop	Tilt lever not matching	
–	–	On	SAS/OPS	Attachment 1 stop	Attachment 1 not matching	
–	–	On	SAS/OPS	Attachment 2 stop	Attachment 2 not matching	